

Approved For Release 2001/11/01 : CIA-RDP66B00664R000600170062-9

DATE 1737Z 16 MAR 64

SECRET

ROUTING	
1	9
2	10
3	11
4	12
5	13
6	14
7	15
8	16

TO : DIRECTOR
 FROM : [REDACTED] 25X1A
 ACTION: OPS 1-12
 INFO :

ROUTINE

TOR 1842Z 16 MAR 64

25X1A

IN-68071

TO [REDACTED] 25X1A INFO [REDACTED] CITE [REDACTED] 2507
 102 25X1A

1. 004
 2. 14/50/400
 3. P-6-1000/215-3-11-63
 4. 32/.024 EFF/YELLOW
 5. ON TIME
 6. LOCALLY/160841Z
 7. TRACKER MALFUNCTION OCCURRED APPROX 4 HOURS AFTER TAKEOFF. FAILURE DUE TO SCAN LEVER FREEZING TO THE RATCHET PAWL. THIS IS A NEW LEVER AND WE HAVE EXPERIENCED SIMILAR PROBLEMS WHEN NEW LEVERS WERE INSTALLED IN [REDACTED] S/N 4 AND S/N 17.
- THE MANUFACTURED FINISH OF THESE LEVERS DOES NOT APPEAR TO BE THE SAME AS THE TYPE ONCE USED. AFTER A FEW HOURS OF OPERATION, AT ALTITUDE, THE LEVER BECOMES SCORED AND THE SCAN SOLENOID CANNOT FORCE THE LEVER OUT OF ITS HOME POSITION. STILL HAVE SOME OF THE OLD TYPE LEVERS AND WILL MAKE A COMPARISON CHECK AS SOON AS POSSIBLE.

25X1A

GROUP 1
 Excluded from automatic
 downgrading and
 declassification

25X1A

2507 (IN-68071)

S E C R E T

PAGE TWO

8. FREE

9. CLEAR

10. SATISFACTORY

11. NONE

12. MOSTLY CLEAR

END OF MESSAGE

S E C R E T